





Invisible bond

Enhance your design appearance with virtually invisible bonding — a game-changing approach for your design concepts. Explore new possibilities and use new, innovative materials to improve the look of your products while optimizing performance, preventing bi-metallic corrosion and streamlining your production processes.



A durable difference

With a bond that's built to withstand the rigors of exposure, 3M VHB Tapes resist hot, cold and cycling temperatures, UV light, moisture and solvents. They seal against environmental conditions and damp vibration to reduce metallic wear-and-tear.





Demanding strength

For your most demanding bonding applications, 3M™ VHB™ Tapes distribute dynamic or static stress over the entire surface of the design, improving holding strength and eliminating the need for mechanical fasteners.



Application efficiency

3M VHB Tapes are simple and easy to apply, saving you time and money. The tapes bond on contact, assemble easily and can be cut to precise shapes and sizes for custom applications. 3M VHB Tapes don't require a cure time and can be used in pre-assembly processes.


Applications and Innovations




The Proven, High Strength Alternative to Mechanical Fasteners

3M™ VHB™ Tape offers manufacturers a distinct bonding advantage by spreading stress loads across the entire length of the joint, permanently adhering materials with a powerful bond.

It's time to replace screws, rivets, welds and other traditional fasteners with a better solution — 3M VHB Tape.

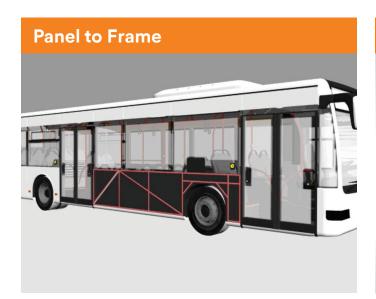

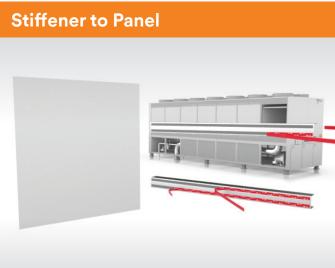



Solve dynamic force challenges while reducing weight and producing a clean, sharp look.



Experience the freedom to create unique designs with exceptional vibration and corrosion resistance.



Dream. Design. Deliver.

Durability for Long-Term Performance

- Resist cold, UV light, temperature cycling, moisture and solvents
- Seal against environmental conditions

Design Flexibility

- Expand the range of material options for high impact visual combinations
- Use lighter weight and thinner materials to lower component and transportation costs





Decorative Material Attachment





Your Application Advantage 3M Expertise and Support

_VINK 🔷


Develop product innovations and improve process efficiencies with the science of 3M[™] VHB[™] Tape and the support of 3M application specialists.

3M VHB Tape has been tested again and again to ensure ultimate performance. Our experienced application experts stress, pull, dunk, freeze and burn 3M VHB Tape to understand how it reacts in many environments. Engineers, designers, architects and regulators can have confidence that





3M supports every application with an extraordinary team of dedicated Application Engineers who consult with designers to help solve difficult design challenges and reveal new design opportunities. When you choose 3M VHB Tape, you get more than an amazing product, you get access to our global support network of technical expertise.

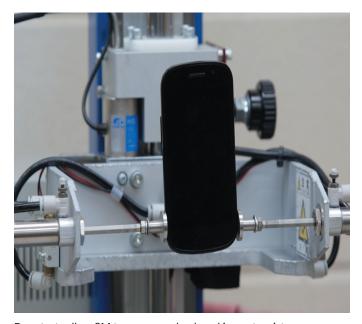

Drop tests allow 3M to compare shock and impact resistance of products used to bond devices.




Our experts invest thousands of hours every year testing customers' substrates and designs, ensuring the right products are selected for each application and delivering the best results possible.




3M™ VHB™ Tape will perform every day, at the highest level possible. Test after test, the tape's closed cell, acrylic construction stands up to water, dirt, dust and many chemicals.

Our deep expertise in bonding dissimilar materials for challenging applications is unmatched. 3M stands alone in its capabilities, facilities and experience. Leverage our expertise to your competitive advantage.




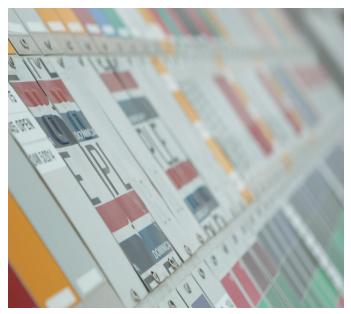

3M performs weathering tests on many of our products using the most advanced weather facilities in the world. Substrates bonded with 3M VHB Tape are subjected to artificial indoor tests and real-world outdoor tests to determine the effects of years of extreme weathering. Exposing them to extreme UV radiation, water and heat ensures your products can stand the test of time.

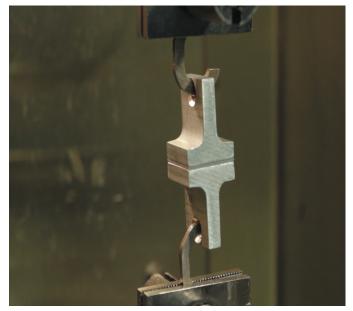

Dynamic normal tensile test: Quantifies the internal cohesive strength of 3M VHB Tape. Unlike mechanical fasteners, the viscoelastic foam core of 3M VHB Tape absorbs the tensile stress, spreading the stress throughout the entire bond.

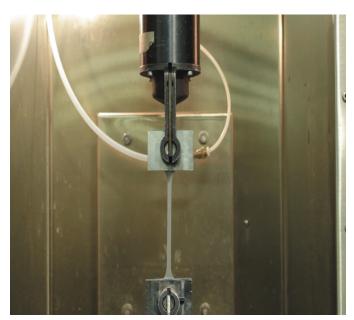

Tensile and elongation tests: Used to compare 3M VHB Tape's elongation versus adhesives. Unlike traditional joining methods, 3M VHB Tape can isolate stresses by allowing them to move independently, while still maintaining a strong hold.




Design and Application Guidelines

Selecting the Right 3M™ VHB™ Tape for Your Application

Our application experts are here to consult with your team to determine the correct 3M VHB Tapes for your product design and production process. When you're reviewing options, consider these factors:

- SUBSTRATES Surfaces function and interact with adhesives differently, based on their properties and surface energy. Test the surface for both the flow of the adhesive and the ability to achieve contact with the other surface.
- THICKNESS Choose tapes with higher thickness to correspond with higher rigidity and flatness irregularity of your materials. Use thinner tapes when working with more flexible materials.
- QUANTITY Consider the variables of viscoelasticity, strength, stiffness, stress and creep behavior when determining the amount of tape for a dynamic load versus a static load.
- EXPANSION/CONTRACTION Tapes can typically tolerate differential movement in the shear plane up to three times their thickness.
- BOND FLEXIBILITY Because tape bonds can be more flexible, applications that need higher stiffness may benefit from corresponding design modifications.
- COLD TEMPERATURES Evaluate applications that require performance at severe cold temperatures to assure proper adhesion performance.
- SURFACE PREPARATION Ensure your surfaces are clean and pressure is applied after tape application for optimal adhesion.

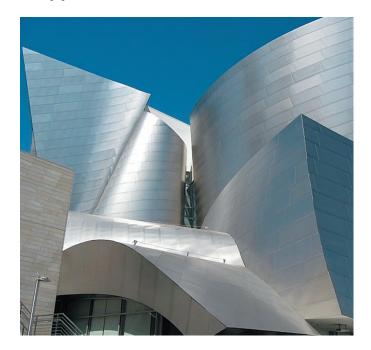







iv. 13/11-2023

Go-To Products Chart



3M™ VHB™ Tapes help you design beyond the limits of mechanical fasteners, to build better products, improve productivity and enhance performance. A great place to get started is the Go-To Products Chart, which offers a range of products well-suited for a variety of projects and applications.

Product Number	Tape Thickness w/o liner Mils (mm)	Page No.	Application Ideas
4941 Tape Family			
4926	15 (0.4)	10	
4936	25 (0.6)	10	
4936F	25 (0.6)	10	
4941	45 (1.1)	10	
4941F	45 (1.1)	10	Bond and seal polycarbonate lens over LCD
4956	62 (1.6)	10	Bond and seal plastic windows to pre-painted control panels/switch gear
4956F	62 (1.6)	10	Mount vinyl wiring ducts and conduit channels
4991	90 (2.3)	10	Seam vinyl banners
4991B	90 (2.3)	10	
4919F	25 (0.6)	10	
4947F	45 (1.1)	10	
4979F	62 (1.6)	10	
5952 Tape Family			
5906	6 (0.15)	12	Bond and seal polycarbonate lens over LCD
5907	8 (0.2)	12	Lens and touch panel bonding
5908	10 (0.25)	12	Logo attachment
5909	12 (0.3)	12	POP and display construction
5915	16 (0.4)	12	
5915P	16 (0.4)	12	
5915WF	16 (0.4)	12	
5925	5925 25 (0.6)	12	
5925P	25 (0.6)	12	
5925WF	25 (0.6)	12	
5930	32 (0.8)	12	Bonds to a variety of plastics and paint systems
5930P	32 (0.8)	12	Bond architectural signs to frames Attach trim and extrusions
5930WF	32 (0.8)	12	Hat channels and stiffeners
5952	45 (1.1)	12	
5952P	45 (1.1)	12	
5952WF	45 (1.1)	12	
5962	62 (1.6)	12	
5962P	62 (1.6)	12	
5962WF	62 (1.6)	12	
5958FR	40 (1.0)	12	Bonds to a variety of plastics and paint systems Bond architectural signs to frames Attach trim and extrusions Hat channels and stiffeners Meets FAR 25.853 (a) 12 second vertical burn, Appendix F, Part I (a)(ii)
RP Tape Family			
RP16	16 (0.4)	14	
RP16F	16 (0.4)	14	
RP25	25 (0.6)	14	
RP25F	25 (0.6)	14	Panel bonding
RP32	32 (0.8)	14	Stiffener attachment
RP32F	32 (0.8)	14	Trim attachment
RP45 45 (1.1) 14 LED and sign component bonding		LED and sign component bonding	
RP45F	45 (1.1)	14	
RP62	62 (1.6)	14	
RP62F	62 (1.6)	14	

3M[™] VHB[™] Tape Selection

Note: The technical information and data provided here should be considered representative or typical only and should not be used for specification purposes. User should evaluate the 3M product to determine whether it is fit for a particular purpose and suitable for user's method of application.

Relative Adhesion:

HSE - High Surface Energy

LSE - Low Surface Energy

Liner Types:

- A 3 mil 54# Densified Kraft Paper
- **B** 5 mil Clear Polyethylene Film
- C-2 mil Polyester Film
- **D** 5 mil Red Polyethylene Film
- E 4 mil 58# Polycoated Kraft Paper
- F 5 mil Red Printed Polyethylene Film
- **G** 3 mil Clear Polyethylene Film
- H-5 mil Green PE Film

Product	Tape Thickness Liner			Adhesive	Temperature Resistance		
Number	w/o Liner mils (mm)	Туре	Description	Туре	Minutes Hours	Days Weeks	
4941 Tape Fan	nily						
4926	15 (0.4)	А					
4936	25 (0.6)	А					
4936F	25 (0.6)	F					
4941	45 (1.1)	А	Gray, closed-cell acrylic foam tape. Excellent combination of strength, conformability and		300°F (150°C)	200°F (93°C)	
4941F	45 (1.1)	D	adhesion to high and medium surface energy materials. Plasticizer resistant. UL 746.				
4956	62 (1.6)	А		Multi-purpose			
4956F	62 (1.6)	F		Acrylic			
4991	90 (2.3)	F			250°F (121°C)	200°F	
4991B	90 (2.3)	F	Black version of 4991.			(93°C)	
4919F	25 (0.6)	F	Black version of 4936F.				
4947F	45 (1.1)	F	Black version of 4941F.		300°F (150°C)	200°F (93°C)	
4979F	62 (1.6)	F	Black version of 4956F.				

Multi-purpose Acrylic: Bonds to a wide range of materials including metals, glass and high and medium surface energy plastics and paints. Resists migration of plasticizers in vinyl substrates.

Modified Acrylic: Bonds to medium and low surface energy paints and plastics, including many powder coated paints, in addition to the substrates listed with the multi-purpose acrylic adhesive (except plasticized vinyl).

General Purpose Acrylic: Bonds to most higher surface energy substrates including metal, glass and high surface energy plastics.

Low Temperature Acrylic: Bonds down to 32°F (0°C) compared to 50°F (10°C) for most acrylic adhesives. Bonds most high surface energy substrates including metal, glass and high surface energy plastics.

Low Surface Energy: High performance synthetic adhesive bonds to many lower surface energy substrates, including polypropylene, polyethylene, and some powder coated paints.

Solvent	Relative Adhesion			Product						
Resistance	HSE	LSE	Color	Number						
4941 Tape Family										
			Gray	4926						
			Gray	4936						
			Gray	4936F						
			Gray	4941						
									Gray	4941F
Himb	l li ala	n Medium	Medium		Gray	4956				
High	High			Gray	4956F					
			Gray	4991						
				Gray	4991B					
						Gray	4919F			
			Gray	4947F						
			Gray	4979F						



Product	Product Tape Thickness	Liner		Adhesive	Temperature Resistance		
Number	w/o Liner Type Description		Type	Minutes Hours	Days Weeks		
952 Tape Far	mily						
5906	6 (0.15)	G					
5907	8 (0.2)	G	Black, closed-cell acrylic foam tape. High dynamic stress				
5908	10 (0.25)	G	resistance and adhesion to multiple surfaces.				
5909	12 (0.3)	G					
5915	16 (0.4)	F					
5915P	16 (0.4)	Е					
5915WF	16 (0.4)	F					
5925	25 (0.6)	F					
5925P	25 (0.6)	E	Black or white, closed-cell acrylic foam tape. Good adhesion to many painted surfaces, including powder	Modified 30 Acrylic (150		250°F (121°C)	
5925WF	25 (0.6)	F			00005		
5930	32 (0.8)	F			(150°C)		
5930P	32 (0.8)	Е					
5930WF	32 (0.8)	F	coated paint. UL 746C.				
5952	45 (1.1)	F					
5952P	45 (1.1)	Е					
5952WF	45 (1.1)	F					
5962	62 (1.6)	F					
5962P	62 (1.6)	Е					
5962WF	62 (1.6)	F					
5958FR	40 (1.0)	F	Meets FAR 25.853 (a) 12 sec vertical burn Appendix F, Part 1 (a) (ii).			200°F (93°C)	

Solvent	Relative /	Adhesion		Product	
Solvent Resistance	HSE	LSE	Color	Number	
5952 Tape Family					
				Black	5906
			Black	5907	
			Black	5908	
			Black	5909	
			Black	5915	
			Black	5915P	
			White	5915WF	
				Black	5925
			Black	5925P	
			White	5925WF	
High	High	Medium	Black	5930	
			Black	5930P	
			White	5930WF	
			Black	5952	
			Black	5952P	
				White	5952WF
			Black	5962	
			Black	5962P	
			White	5962WF	
			Black	5958FR	

Product	Tape Thickness Liner		Adhesive	Temperature Resistance		
Number	w/o Liner mils (mm)	Туре	Description	Type	Minutes Hours	Days Weeks
RP Tape Family	y					
RP16	16 (0.4)	Α				
RP16F	16 (0.4)	F				
RP25	25 (0.6)	А				
RP25F	25 (0.6)	F				
RP32	32 (0.8)	А	Gray, closed-cell acrylic foam tape. Conformable.		250°F	200°F
RP32F	32 (0.8)	F	Good adhesion to many painted metals.	Multi-purpose	(121°C)	(93°C)
RP45	45 (1.1)	А				
RP45F	45 (1.1)	F				
RP62	62 (1.6)	Α				
RP62F	62 (1.6)	F				
GPH Tape Fam	ily					
GPH-060GF	25 (0.6)	F	Gray, closed-cell, conformable acrylic foam. Superior	Modified Acrylic	450°F (230°C)	300°F (150°C)
GPH-110GF	45 (1.1)	F	high-temperature performance for powder coat or liquid			
GPH-160GF	62 (1.6)	F	paint processes and multi material bonding.			
4945 Tape Far	nily					
4945	45 (1.1)	А	White, closed-cell acrylic foam	Multi-purpose	300°F	200°F
4946	45 (1.1)	В	tape. Plasticizer resistant.	widiti puipose	(150°C)	(93°C)
4952 Tape Far	nily					
4932	25 (0.6)	А	White, closed-cell acrylic foam tape. Good adhesion to	Low Surface Energy	200°F	160°F
4952	45 (1.1)	А	polypropylene and many powder paints. Suggested for indoor use.	Adhesive	(93°C)	(71°C)
4622 Tape Far	nily					
4618	25 (0.6)	Н		General		
4622	45 (1.1)	Н	White, closed-cell acrylic foam tape.	Purpose Adhesive/	250°F (121°C)	200°F (93°C)
4624	62 (1.6)	Н		Multi-purpose		

Solvent	Relative Adhesion			Product					
Resistance	HSE	LSE	Color	Number					
RP Tape Family									
			Gray	RP16					
			Gray	RP16F					
			Gray	RP25					
			Gray	RP25F					
Himb	l li alb	NA a divers	Gray	RP32					
High	High	Medium	Gray	RP32F					
			Gray	RP45					
			Gray	RP45F					
			Gray	RP62					
			Gray	RP62F					
GPH Tape Family									
								Gray	GPH-060GF
High	High	Medium	Gray	GPH-110GF					
			Gray	GPH-160GF					
4945 Tape Family									
High	High	Low	White	4945					
riigii	riigii	LOW	White	4946					
4952 Tape Family									
High	High	High	White	4932					
riigii	riigii	riigii	White	4952					
4622 Tape Family									
			White	4618					
High	High	Low	White	4622					
			White	4624					

Product Number	Tape Thickness w/o Liner mils (mm)	Liner Type	Description	Adhesive Type	Minutes	e Resistance Days
4950 Tape Fai					Hours	Weeks
4914	10 (0.25)	А				
4920	15 (0.4)	А				
4929	25 (0.6)	С				
4930	25 (0.6)	A			300°F	200°F
4930F	25 (0.6)	D	Closed-cell acrylic	General Purpose	(150°C)	(93°C)
4949	45 (1.1)	С	foam tape. UL 746C.	Acrylic		
4950	45 (1.1)	Α				
4955	80 (2.0)	С				
4959	120 (3.0)	С			400°F	300°F
4959F	120 (3.0)	D			(204°C)	(150°C)
4951 Tape Fan	nily					
4951	45 (1.1)	С	White, closed-cell acrylic foam tape. Apply at temps as low as 32°F (0°C).			
4943F	45 (1.1)	С	Gray, closed-cell acrylic foam tape. Apply at temps	Low Temperature Appliable Acrylic	300°F (150°C)	200°F (93°C)
4957F	62 (1.6)	С	as low as 32°F (0°C).			
4910 Tape Far	nily					
4905	20 (0.5)	F	Clear, acrylic construction for	General	300°F	200°F
4910	40 (1.0)	F	joining transparent material.	Purpose	(150°C)	(93°C)

Solvent	Relative Adhesion			Product											
Resistance	HSE	LSE	Color	Number											
4950 Tape Family															
			White	4914											
			White	4920											
			Black	4929											
			White	4930											
High	High	Low	White	4930F											
			Low	LOW	riigii Low		Black	4949							
									White	4955					
									White	4959					
			White	4959F											
4951 Tape Family															
			White	4951											
High	High	Low	Gray	4943F											
			Gray	4957F											
4910 Tape Family															
High	High	Low	Clear	4905											
Tilgii	111911	LOW	Clear	4910											

Putting it All Together



Choose the Right Primer for Your Surface

For some challenging substrates, a primer or adhesion promoter may improve the reliability of the bond. Consult with 3M Technical Service to determine if a surface preparation step will be required for your application.

Product	Solvent	Active Ingredients	VOCs	Color	Flashpoint	Coverage
3M [™] Primers						
AP111	Isopropyl Alcohol (IPA)	Less than 5% by weight	5.91 lbs/gallon (708 g/l)	Clear	52°F (11°C)	800 ft²/gal (19m²/liter)
AP115	Isopropyl Alcohol and Water	Less than 1% by weight	6.08 lbs/gallon (728 g/l)	Clear	53°F (12°C)	815 ft²/gal (20m²/liter)
Primer 94	See SDS	See SDS	Approximately 6.3 lbs/gallon (755 g/l) less H ₂ O and exempt solvents	Clear light yellow to clear dark orange	-4°F (-20°C)	600 ft²/gal (15m²/liter)
Primer UPUV	See SDS	Approximately 5% by weight	3.58 lbs/gallon (429 g/l)	Clear	-5°F (-21°C)	600 ft²/gal (15m²/liter)

Note: The technical information and data on these pages should be considered representative or typical only and should not be used for specification purposes. Coverage can depend on the application method and the substrate.

How to Prepare Specific Surfaces

- **HEAVY OILS** remove oil or grease using a degreaser or solvent-based cleaner.
- ABRASION Abrade the surface to remove heavy dirt or oxidation.
- **HIGHER ADHESION** Prime surfaces to increase adhesion especially for paint or plastic surfaces.
- POROUS SURFACES Seal surfaces such as wood, particle board or concrete.
- GLASS Use silane treatment.
- OTHER MATERIALS Consider the potential for special surface preparation for all materials, including metal, copper, plastics, rubber and more.



Applying 3M[™] VHB[™] Tapes



step 1: Align the materials — and make sure all surfaces are clean and dry. Use a 50:50 mix of isopropyl alcohol and water before applying tapes.



STEP 2: When surfaces are dry, apply 3M VHB Tape to the surface.




STEP 3: Apply pressure with a J-roller to at least 15 psi (100 kPa). This will help develop high-strength adhesion and bonding. Bond strength will increase after application.

APPROXIMATE TIME TO ACHIEVE ULTIMATE BOND STRENGTH:

- 50% after 20 minutes
- 90% after 24 hours
- 100% after 72 hours

Bond strength may be achieved more quickly and in some cases, may be increased by exposing the bond to elevated temperatures (e.g. 150°F (66°C) for 1 hour).

BOND TYPICAL BUILD vs. TIME

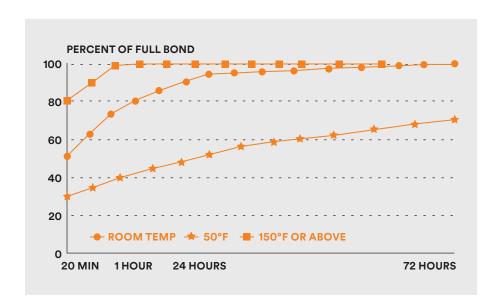



Product Selection and Use: Many factors beyond 3M's control and uniquely within user's knowledge and control can affect the use and performance of a 3M product in a particular application. As a result, customer is solely responsible for evaluating the product and determining whether it is appropriate and suitable for customer's application, including conducting a workplace hazard assessment and reviewing all applicable regulations and standards (e.g., OSHA, ANSI, etc.). Failure to properly evaluate, select, and use a 3M product and appropriate safety products, or to meet all applicable safety regulations, may result in injury, sickness, death, and/or harm to property.

Warranty, Limited Remedy, and Disclaimer: Unless a different warranty is specifically stated on the applicable 3M product packaging or product literature (in which case such warranty governs), 3M warrants that each 3M product meets the applicable 3M product specification at the time 3M ships the product. 3M MAKES NO OTHER WARRANTIES OR CONDITIONS, EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OR CONDITION OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR ARISING OUT OF A COURSE OF DEALING, CUSTOM, OR USAGE OF TRADE. If a 3M product does not conform to this warranty, then the sole and exclusive remedy is, at 3M's option, replacement of the 3M product or refund of the purchase price.

Limitation of Liability: Except for the limited remedy stated above, and except to the extent prohibited by law, 3M will not be liable for any loss or damage arising from or related to the 3M product, whether direct, indirect, special, incidental, or consequential (including, but not limited to, lost profits or business opportunity), regardless of the legal or equitable theory asserted, including, but not limited to, warranty, contract, negligence, or strict liability.



Industrial Adhesives and Tapes Division 3M Center, Building 225-3S-06 St. Paul, MN 55144 USA

Phone 1-800-362-3550 Web 3M.com/VHB

